


1-800-547-5740 • Fax: (503) 643-6322 www.ueitest.com email: info@ueitest.com

#### INTRODUCTION

The **AGENT** RLD15 features a long life heated sensor technology that is designed to detect the more current and difficult HFC refrigerants such as R134a, R410A, R404A, R407C, in addition to all HCFC (R22) and CFC (R12) refrigerants including SNAP approved hydrocarbon blends.


#### **GETTING STARTED**

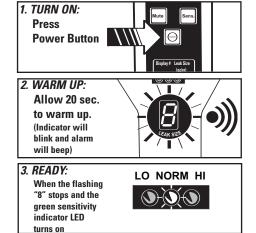

#### **LEAK TEST VIAL**

The Leak detector comes with a Leak Test Vial that allows the user to make sure the detector is performing properly. To test: Turn the detector on and allow the unit to warm-up.



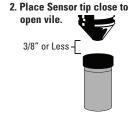

3. The beep rate should increase and the Digital **Leak Size Indicator** should display a number from 4 - 6 indicating that the sensor and electronics are working properly



#### 4. Replace Seal Cap

NOTE: Always remember to replace plastic seal cap after leak test is completed. Replace Test Vial when the blue color is no longer visible.



#### **FEATURES**

#### **LEAK SIZE INDICATOR**



The digital leak size indicator remains off until a leak is detected, a number from 1 - 9 will be displayed for all HFC and HCFC refrigerants. Regardless of the sensitivity settings.

The number will increase or decrease depending on the amount of refrigerant sensed. The maximum value will be displayed once the leak source has been located.

#### **Approximate Size Indications**

Maximum # Displayed	Leak Size (oz/yr)
1-3	< 0.1
4-6	0.1 - 0.5
7-9	> 0.5

#### **AUDIO MUTE FUNCTION**

1. Press Mute **Button to** Mute Speaker.



#### SENSITIVITY LEVEL

1. Press Sens. **Button to** Change / Scroll **Sensitivity** Levels. (Indicated By LED) -




#### LOW BATTERY INDICATOR



Replace batteries when flashing

#### **BATTERY REPLACEMENT:**

- 1. Remove battery cover on back of instrument, (Fig1)
- 2. Replace batteries (4 AA) with correct polarity.

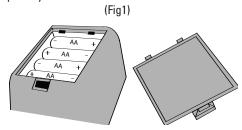


# LIMITED WARRANTY

The AGENT is warranted to be free from defects in materials and workmanship for a period of three years from the date of purchase. If within the warranty period your instrument should become inoperative from such defects, the unit will be repaired or replaced at UEi's option. This warranty covers normal use and does not cover damage which occurs in shipment or failure which results from alteration, tampering, accident, misuse. abuse, neglect or improper maintenance. Batteries and consequential damage resulting from failed batteries are not covered by warranty.


Any implied warranties, including but not limited to implied warranties of merchantability and fitness for a particular purpose, are limited to the express warranty. UEi shall not be liable for loss of use of the instrument or other incidental or consequential damages, expenses, or economic loss, or for any claim or claims for such damage, expenses or economic loss. A purchase receipt or other proof of original purchase date will be required before warranty repairs will be rendered. Instruments out of warranty will be repaired (when repairable) for a service charge. Return the unit postage paid and insured to:

#### UEi 8030 SW Nimbus Ave.

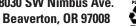


#### FILTER REPLACEMENT

1. Replace Filter: Unscrew sensor tip as shown to replace filter. Replace filter whenever it becomes visibly dirty or every 2 to 3 months depending on use.

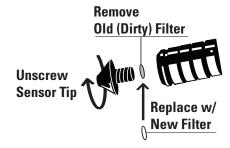


#### SENSOR REPLACEMENT

1.) Remove sensor by unscrewing sensor tip and pulling out the socket.

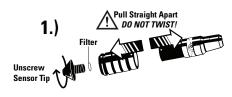

2.) Install the new sensor by aligning the mark on the sensor cover with that on the probe and pressing together.

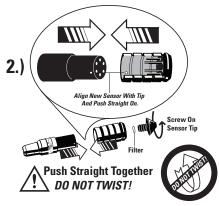

## WARNING

DO NOT TWIST OR FORCE THE SENSOR INTO THE SOCKET.

Misalignment can damage the sensor pins.

### **SPECIFICATIONS**

Model #	RLD15
Name	AGENT 1
Sensitivity	.05 oz/yr R134a
	.025 oz/yr R22
Sensor Life	> 300 Hours
Response Time	≤ 1sec
Power Supply	4 AA Alkaline
Battery Life	8 Hrs. Continuous
Warm-Up Time	<20 Seconds
Probe Length	17 inches
Numerical Display	7 Segment Digital (1-9)
Weight, lbs	1.5 Lbs
Warranty	3yr (Includes Sensor)

#### **Cross Sensitivity to Automotive Chemicals**

Some Automotive solvents and chemicals have similar hydrocarbon properties as R134a and may elicit a positive response (< 30 seconds) from the AGENT. Before leak detecting, clean up any chemicals in the list below that elicit a response.

> Dextron Transmission Fluid heated to 160°F Quaker State motor oil heated to 160°F Rain-X Windshield wash fluid Ford silicone lubricant Ford Gasket adhesive (when wet) Ford rust inhibitor (when wet) Loctite Natural Blue Degreaser (undiluted) Ford brake parts cleaner (when wet) Ford silicone rubber (when uncured) Motorcraft antifreeze heated to 160°F Gunk liquid wrench (when wet) Ford spot remover (when wet) Ford pumice lotion (with mineral solvent) Ford motorcraft brake fluid Ford carburetor cleaner (when wet)